


DESIG	N DRA	AWN BY	DART AEROSPACE LTI HAWKESBURY, ONTARIO, CANADA	)
CHEC	KED APP	PROVED	DRAWING NO.	REV. A
. <	HA .	9	DSI 9210 SHE	ET 1 OF 1
DATE		/	TITLE	SCALE
01.0	06.01		SKIDTUBE REPAIR	NTS
Α	(	01.06.01	NEW ISSUE	

## **DART SERVICE INSTRUCTION**

TO AMEND MMS-D206-642 REV. B

REF. CANADIAN STC: SH98-4 REF. FAA STC: SA00475SE

EFFECTIVE: ALL D206-642-XXX SKIDTUBES
REPAIR DAMAGE TO END 1 INCH AREA OF SKIDTUBE AS FOLLOWS:

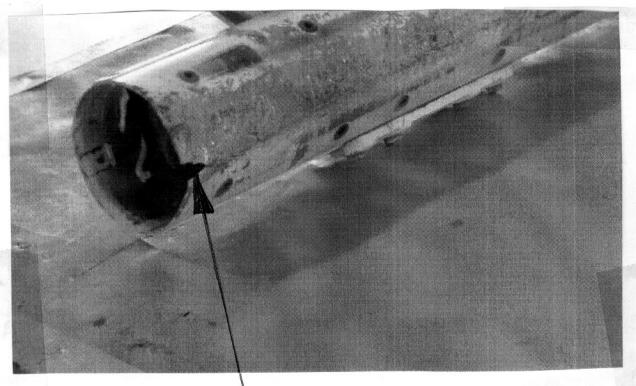

- BLEND DAMAGED AREA EDGES TO STOP CRACK PROPOGATION TO MAX LENGTH OF OF 1 INCH.
- TOUCH UP AFFECTED AREAS WITH CHEMICAL FILM MATERIAL (ALODINE 1200 OR 1201) PER MIL-C-5541, ONE COAT OF MIL-P-85582 OR MIL-P-23377 PRIMER, AND 2-3 COATS OF MIL-C-85285 POLYURETHANE PAINT TO MATCH ORIGINAL FINISH.
- 3. REPLACE D2646 END CAP PER INSTALLATION INSTRUCTIONS D206-642.
- CAULK TO SEAL D2646 END CAP PER INSTALLATION INSTRUCTIONS D206-642 USING PROSEAL 890 OR SIKAFLEX-241/291.



Copyright @ 2001 by DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.